

GRUMMAN AMERICAN AVIATION CORPORATION

318 BISHOP ROAD, CLEVELAND, OHIO 44143
(216) 449-2200 TELEEX NO. 960-245

WIRE BULLETIN NO. 124

DATE: SEPTEMBER 3, 1971
TO: OWNERS & OPERATORS OF TRAINER AIRCRAFT WITH COM II RADIO INSTALL
SUBJECT: MODIFICATION OF 902026-1 REAR RADIO SUPPORTS
MODELS AFFECTED: AA1A-0141, 0149, 0152, 0159, 0153, 0188 AND 0203
TIME OF COMPLIANCE: IMMEDIATELY

TO PREVENT THE POSSIBILITY OF INTERFERENCE BETWEEN THE REAR VERTICAL RADIO SUPPORTS AND THE CONTROL COLUMN, THE FOLLOWING MUST BE ACCOMPLISHED.

TRIM .60 INCHES OFF THE BOTTOM EDGE OF BOTH REAR VERTICAL RADIO SUPPORTS. AFTER TRIMMING, APPLY FULL BACK PRESSURE TO THE CONTROL COLUMN AND ROTATE AILERONS (FULL TRAVEL BOTH DIRECTIONS), AND CHECK FOR INTERFERENCE BETWEEN THE AFT RADIO SUPPORTS AND THE CONTROL COLUMN.